


i	
Md	14 = 80Nm 21 = 50Nm 38 = 20Nm 42 = 30Nm
	14, 22, 42
	2 3 4

(1-48)
0

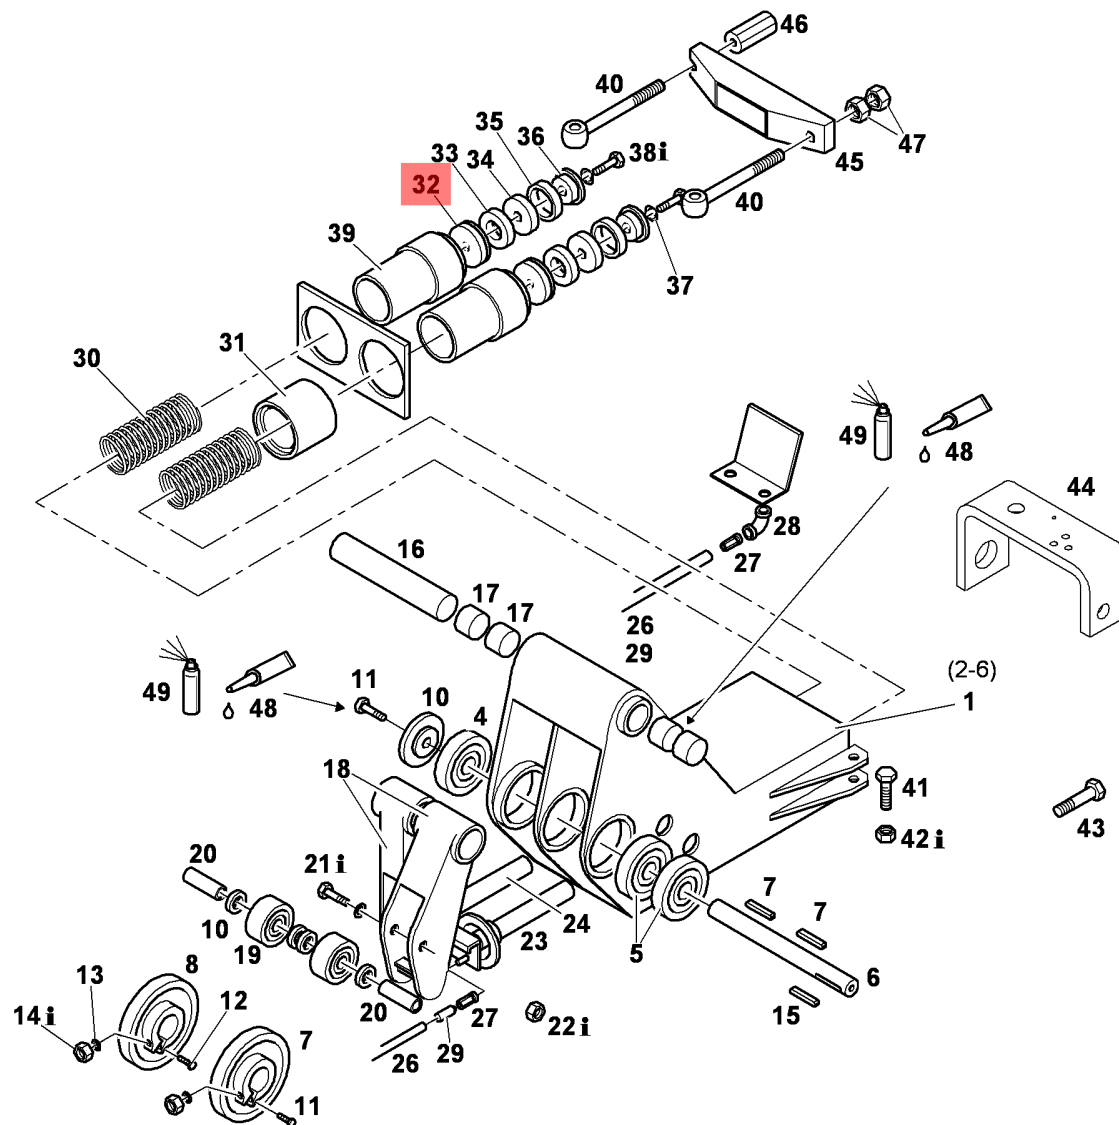

 **6.0**
45575-1008
© Putzmeister Mörtelmaschinen GmbH 2010

Zeichnung
Info-Logo
go.bmp

Mörtelpumpe KK139

Zeichnung

Zeichnung
ch¹ - ch

6.0
45575-1011

0	435269	1	Mörtelpumpe	KK139
1	212217005	1	.Antriebsgehäuse	
2	036507001	3	..Sicherungsscheibe	VS12 / Poly 10X10
3	032379000	3	..Sechskantschraube	M12x40 DIN933-8.8/Poly 10X10
4	034207002	3	..Sechskantmutter	BM12 DIN6330-10
5	013131005	3	..Rillenkugellager	6312 2RS
6	013138008	1	..Nockenwelle	L=390MM
7	435295	2	..Passfeder	B18x11x80 DIN6885
8	013196008	2	..Nocken	
9	435485	2	..Scheibe	-A-60,3x76,1x8mm-ST
10	435568	1	..Scheibe	-A-16,5x75x5mm-ST
11	013911005	1	..Sechskantschraube	M16x30
12	032170005	4	..Sechskantschraube	M12x85 DIN931-8.8
13	036107003	4	..Federring	A12 DIN127
14	034107005	4	..Sechskantmutter, selbstsi	M12 DIN985-8 / Poly 10X10
15	038229002	1	..Passfeder	A18x11x100 DIN6885
16	013144005	1	..Schwinghebelwelle	
17	013147002	4	..Buchse	50x55x40mm DU
18	540914	2	..Schwenkhebel	
19	013185006	2	..Stützrolle	30X90,1X60MM
20	013134002	2	..Buchse	20x30J6x79mm-ST
21	032229008	2	..Sechskantschraube	M20x95 DIN931-8.8
22	214814008	2	..Sechskantmutter, selbstsi	M8x20
23	434443	1	..Arbeitskolbenstange	
24	435232	1	..Arbeitskolbenstange	
25	013188003	2	..Verschraubung	K-GV 10/8L
26	013161004	2	..Schmierleitung	8x1x670mm
27	044007001	2	..Stutzen	GES 8LR /Poly 10X10
28	040080006	2	..Winkel	1/4" GF90
29	013176002	4	..Einsteckhülse	8x1 /Poly 10X10
30	213969006	2	..Druckfeder	DA=109,5MM LO=505MM C=8MM
31	013172006	2	..Federanlage Zylinderseite	
32	013189002	2	..Kolbenscheibe	DN90X25MM
33	013158004	2	..Filzstreifen	18X12X300MM
34	203287002	2	..Ledermanschette	90X13X20X5
35	013145004	2	..Gummispreizring	80X54X14MM

Zeichnu 435269

Mörtelpumpe KK139

ng
Info-Lo
go.bmp

Zeich2 - Zeich

6.0

45575-1011

Zeichnung

